

# Manhole Inspection Summary

Manhole # S17W\_\_007MH

Printed On: 2/20/2009

Page 1 of 5

**Inspection** ☐ Is Incomplete Rating: **2) Good**

Record Plat: **17W** Node: **007** Status: **Found**

Insp Date: **12/2/08 1:39 PM**

Incomplete Comments

Crew: **REI**  
Inspector: **paulfry**  
Firm: **ATS**

**Location** Address: **1601 SPENCE ST**

Cross Street: **GROVE ST**

**Manhole** Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **Sheeting**

Comments **STEAM IN LINE MADE IT DIFFICULT TO OBTAIN PROPER PIPE PICTURES.  
PREVIOUSLY OCCUPIED BY FLOW MONITOR**

**Cover**

Shape: **Circular**

Diameter: **24** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Other**

Condition: **Worn**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

**Chimney / Frame Adjustment**

☐ Exists

Material:

☐ Parged

Height: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☐ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound

☒ **Cracked**

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☒ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☐ Wall

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☐ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☒ **Wall**

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☐ Debris

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open**

Junc Dist: **0**

nearest .5 ft.

Azimuth: **0**

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☐ Debris

**Steps**

Count: **10** Missing: **0** ☐ Corroded

**Surcharge**

☒ **Evidence Of Surcharge**

Depth: **6**

(ft.)

☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S17W\_\_007MH

Printed On: 2/20/2009

Page 2 of 5

Location View



Top View



Miscellaneous



WORN COVER

MISC.



FLOW MONITOR BOLTS/WIRE

Defect 3



CRACKED CORBEL BRICK

Defect



INFLOW EVIDENCE FROM SHEETING

Defect 2



EVIDENCE OF SURCHARGE

Defect 1



INFILTRATION @ BARREL WALL

## Manhole Inspection Summary


Manhole # S17W\_\_007MH

Printed On: 2/20/2009

Page 4 of 5

15 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow

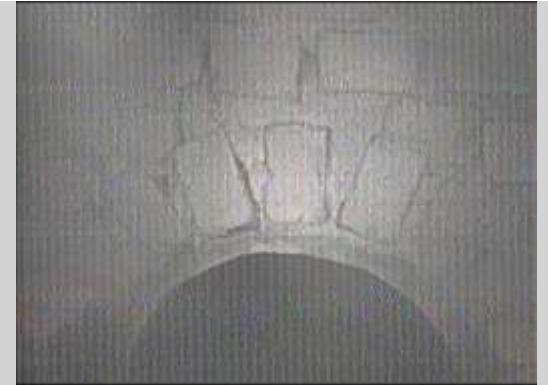

Pipe Height: **15.6** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **15.85** (ft.) Flow Characteristics: **Fast**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: **0** (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 2 O'Clock

2 O'Clock Inflow

Drop In @ 2 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **12.30** (ft.) Flow Characteristics: **Slow**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: **0** (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** Rod and Bar  
Angled: **Yes** Reading: **14.33** (ft.)  
Inv Depth: **15.33** (ft.)  
Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S17W\_\_007MH

Printed On: 2/20/2009

Page 5 of 5

6 in. Circular Gravity Sewer

5 O'Clock Inflow

Pipe In @ 5 O'Clock



Pipe Height: **6** (in.) Rod and Bar (Angled)

Pipe Material: **DIP/CI** ☐ Pipe Lined

Invert Depth: **3.40** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

15 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock



Pipe Height: **15.6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **15.90** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection